



AVOID INSPECTION DELAYS AND REPAIR COSTS - FOLLOW THESE GUIDELINES

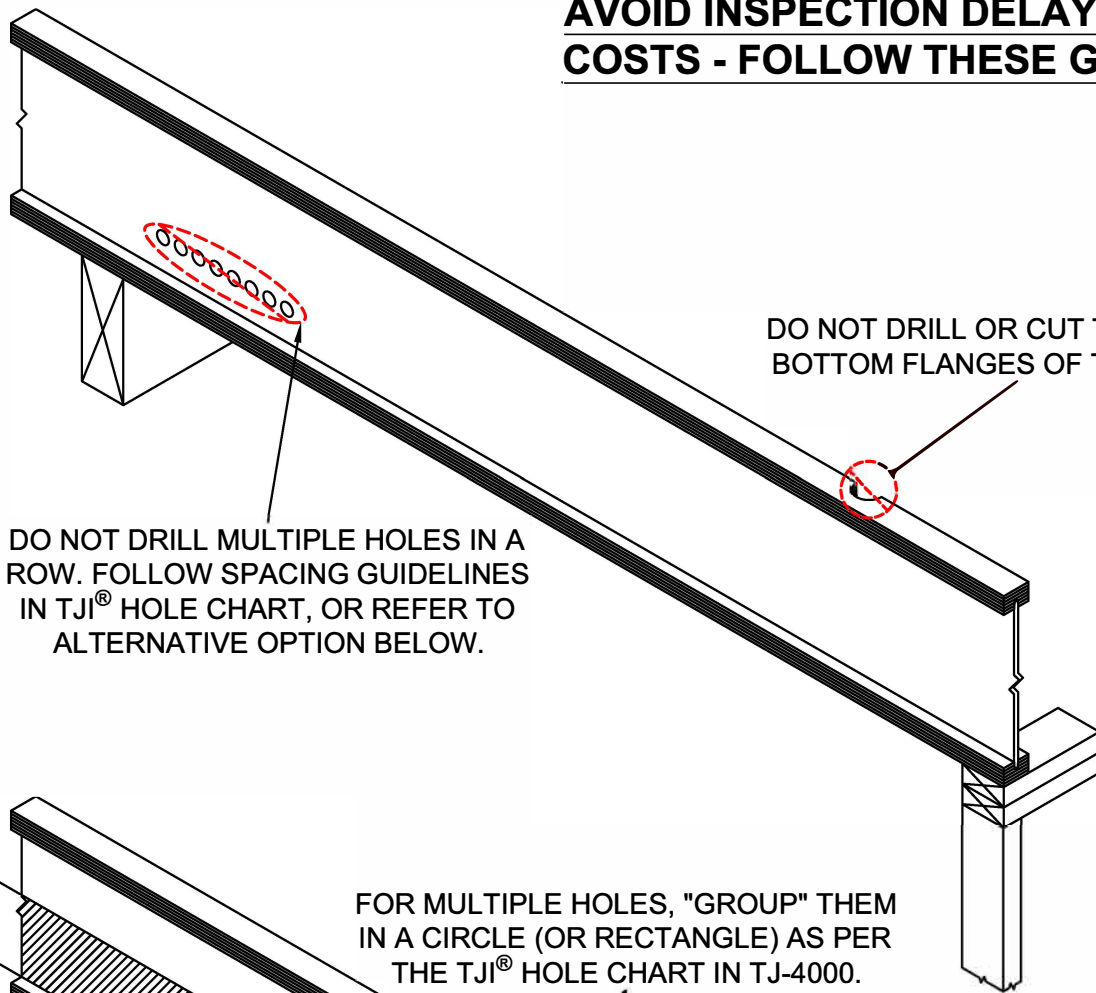

DO NOT DRILL OR CUT THE TOP OR BOTTOM FLANGES OF TJI® JOISTS.

DO NOT DRILL MULTIPLE HOLES IN A ROW. FOLLOW SPACING GUIDELINES IN TJI® HOLE CHART, OR REFER TO ALTERNATIVE OPTION BELOW.

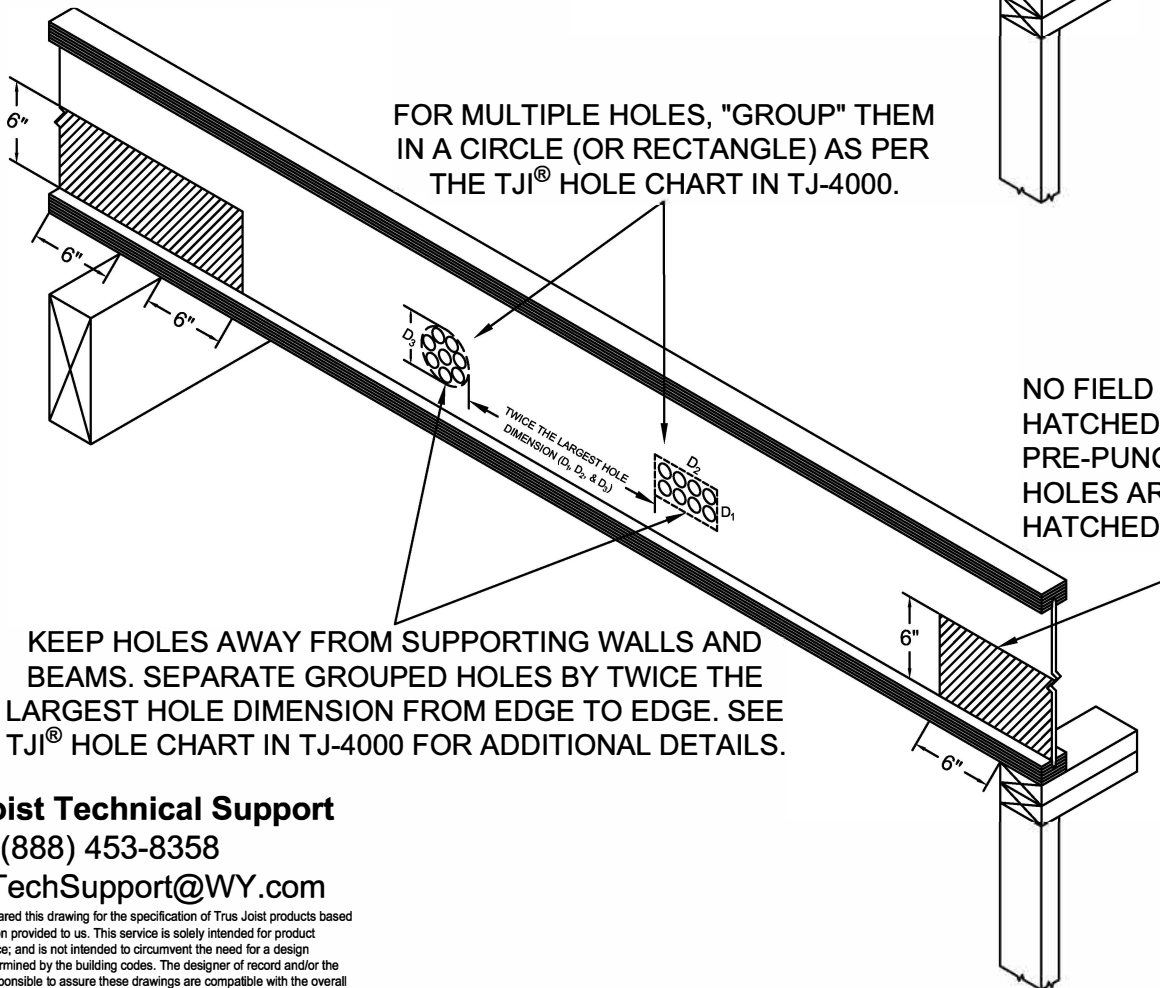

FOR MULTIPLE HOLES, "GROUP" THEM IN A CIRCLE (OR RECTANGLE) AS PER THE TJI® HOLE CHART IN TJ-4000.

NO FIELD CUT HOLES WITHIN HATCHED AREA. PRE-PUNCHED KNOCKOUT HOLES ARE ACCEPTABLE IN HATCHED ZONE.

KEEP HOLES AWAY FROM SUPPORTING WALLS AND BEAMS. SEPARATE GROUPED HOLES BY TWICE THE LARGEST HOLE DIMENSION FROM EDGE TO EDGE. SEE TJI® HOLE CHART IN TJ-4000 FOR ADDITIONAL DETAILS.

Trus Joist Technical Support

Phone: (888) 453-8358

Email: TechSupport@WY.com

Weyerhaeuser prepared this drawing for the specification of Trus Joist products based on project information provided to us. This service is solely intended for product application assurance, and is not intended to circumvent the need for a design professional as determined by the building codes. The designer of record and/or the builder/framer is responsible to assure these drawings are compatible with the overall project.

TJI® JOIST ELECTRICAL HOLE FIELD GUIDE



DETAIL #:
NW-D224

EXPIRATION DATE:
01/01/2023